



HSZ40 Array Controller Operating Software HSOF Version 3.4

Release Notes

This document summarizes features and characteristics of the HSZ40 array controller operating software Versions 3.4, 3.3, 3.2, and 3.1 that are not covered elsewhere in the documentation. These release notes also contain instructions for installing the software and should be retained for future reference.

While Compaq Computer Corporation believes the information included in this manual is correct as of the date of publication, it is subject to change without notice. Compaq makes no representations that the interconnection of its products in the manner described in this document will not infringe existing or future patent rights, nor do the descriptions contained in this document imply the granting of licenses to make, use, or sell equipment or software in accordance with the description. No responsibility is assumed for the use or reliability of firmware on equipment not supplied by Compaq or its affiliated companies. Possession, use, or copying of the software or firmware described in this documentation is authorized only pursuant to a valid written license from Compaq, an authorized sublicensor, or the identified licensor.

Commercial Computer Software, Computer Software Documentation and Technical Data for Commercial Items are licensed to the U.S. Government with Compaq's standard commercial license and, when applicable, the rights in DFAR 252.227 7015, "Technical Data-Commercial Items."

© 1999 Digital Equipment Corporation.
All rights reserved. Printed in U.S.A.

Compaq, the Compaq logo, DIGITAL, DIGITAL UNIX, DECconnect, HSZ, HSD, HSJ, StorageWorks, VMS, OpenVMS Registered in the United States Patent and Trademark Office.

UNIX is a registered trademark in the United States and other countries exclusively through X/Open Company Ltd. Windows NT is a registered trademark of the Microsoft Corporation. Sun is a registered trademark of Sun Microsystems, Inc. Hewlett-Packard, TACHYON, and HP-UX are registered trademarks of the Hewlett-Packard Company. IBM and AIX are registered trademarks of International Business Machines Corporation. All other trademarks and registered trademarks are the property of their respective owners.

This equipment has been tested and found to comply with the limits for a Class A digital device, pursuant to Part 15 of the FCC Rules. These limits are designed to provide reasonable protection against harmful interference when the equipment is operated in a commercial environment. This equipment generates, uses and can radiate radio frequency energy and, if not installed and used in accordance with the manuals, may cause harmful interference to radio communications. Operation of this equipment in a residential area is likely to cause harmful interference in which case the user will be required to correct the interference at his own expense. Restrictions apply to the use of the local-connection port on this series of controllers; failure to observe these restrictions may result in harmful interference. Always disconnect this port as soon as possible after completing the setup operation. Any changes or modifications made to this equipment may void the user's authority to operate the equipment.

Warning!

This is a Class A product. In a domestic environment this product may cause radio interference in which case the user may be required to take adequate measures.

Achtung!

Dieses ist ein Gerät der Funkstörgrenzwertklasse A. In Wohnbereichen können bei Betrieb dieses Gerätes Rundfunkstörungen auftreten, in welchen Fällen der Benutzer für entsprechende Gegenmaßnahmen verantwortlich ist.

Attention!

Ceci est un produit de Classe A. Dans un environnement domestique, ce produit risque de créer des interférences radioélectriques, il appartiendra alors à l'utilisateur de prendre les mesures spécifiques appropriées.

この装置は、情報処理装置等電波障害自主規制協議会（VCCI）の基準に基づくクラスA情報技術装置です。この装置を家庭環境で使用すると電波妨害を引き起こすことがあります。この場合には使用者が適切な対策を講ずるよう要求されることがあります。

This equipment generates, uses, and may emit radio frequency energy. The equipment has been type tested and found to comply with the limits for a Class A digital device pursuant to Part 15 of FCC rules, which are designed to provide reasonable protection against such radio frequency interference. Operation of this equipment in a residential area may cause interference in which case the user at his own expense will be required to take whatever measures may be required to correct the interference. Any modifications to this device - unless expressly approved by the manufacturer - can void the user's authority to operate this equipment under part 15 of the FCC rules.

Contents

Introduction.....	1
Topics Covered	1
Release Package Contents	1
Intended Audience	2
Hardware Support	2
Operating System Support.....	2
Host Adapter Support.....	2
Device Support.....	3
New Items	6
Host-Level I/O Failures.....	6
Correction for TILX Incompatibility with Disks.....	7
EMU Alarm Clarification	7
Action for Repeated Reboots	7
Updated Storageset Limits	7
Write-Back Cache (WBC) Battery Replacement	7
Support for Large-Drive Formatting	7
Support for up to Fourteen 18 GB Drives	7
New Host Mode “F” for Support of Sun Solaris Operating System.....	8
Hot Swapping Devices	8
Features from Previous Releases	9
Battery Handling	9
Battery Handling and the CACHE_UPS Switch	9
Battery Handling and Cache Policy.....	9
Failed Battery Action	10
Extending the Life of Your External-Cache Batteries.....	11
Shutting Down a Controller.....	11
Disabling the Write-Back Cache Batteries	12
Restarting the Controller	12
Logical Device Event Reports.....	13
Logical Block Address Does Not Match for MEDIUM ERROR.....	13
Adding RAIDsets When Battery Condition is Low	13
Drive-Level Event Reports.....	13
Saving the Subsystem Configuration.....	13
Restrictions on Moving Storagesets to Previous Software Versions	14
Unit Problems after Battery Low	15

CLEAR_ERRORS LOST_DATA Command.....	15
Only One Switch per CLI Command Recommended	15
CFMENU Constraints	15
CLONE Utility Constraints	16
Low/Failed Battery on Dual-Redundant Configurations with Preferred Paths.....	16
Device Adds, Moves, and Changes	16
Tape Drive Firmware Revision	16
Running CONFIG or CFMENU Utilities During Backup or Copy Operations	16
Changing Host Adapter Types	16
Moving Write-Back Cache Modules	16
Documentation Additions and Corrections.....	17
Replacing a Controller with C_SWAP	17
CACHE_UPS.....	18
Upgrading HSOF Software.....	18
Dual-Redundant Controller Rolling Upgrade.....	19
Dual-Redundant Controller Shutdown Upgrade.....	20
Single Controller Upgrade.....	21
Identifying Your HSOF Revision Level	22
Order Numbers	22

Introduction

These release notes provide information for the HSZ40 array controller running HSOF Version 3.4. This document should be used by individuals responsible for configuring, installing, and using the HSZ40 controller.

Read this entire document before upgrading the controller's software. The information in these release notes takes precedence over the information in the HS Family of Array Controllers User's Guide.

Topics Covered

These release notes cover the following topics:

- Hardware and software supported by HSOF Version 3.4
- Device Support—Lists of devices supported by HSOF Version 3.4
- New Items—Modifications that are new for HSOF Version 3.4
- Items from Previous Releases—Modifications to operating parameters or functions that were introduced in software versions prior to HSOF Version 3.4
- Documentation Amendments—Additions and corrections to the documentation
- HSOF software installation and upgrade instructions
- Identification of the software revision level
- Order numbers

Release Package Contents

The Version 3.4 release package consists of the following:

- A cover letter
- A PCMCIA program card containing HSOF Version 3.4 software
- The HSZ40 documentation set, which includes many documents produced for HSOF Version 3.1, all still applicable to HSOF Version 3.4:
 - *HSZ40 Array Controller HSOF Version 3.1 Configuration Manual*
 - *HSZ40 Array Controller HSOF Version 3.1 Service Manual*
 - *HSZ40 Array Controller HSOF Version 3.1 CLI Reference Manual*
 - *HSZ40 Array Controller Operating Software Version 3.4 Release Notes*
 - *Array Controller Operating Software (HSOF), Version 3.4 Software Product Description*

Intended Audience

This document has been prepared for Compaq customers who currently use and maintain the HSZ40 array controller.

Hardware Support

HSOF Version 3.4 software supports the following revisions for your controller and associated hardware:

- HSZ40-Bx and HSZ40-Cx controller modules
- Cache module Version 2, hardware revision A or B
- BA350-MA controller shelf
- BA350-Sx 8-bit SCSI device shelf
- BA350-Sx wide shelf with 8-bit or 16-bit personality module (controller operates in 8-bit mode only)
- BA35x-HF power supply

Operating System Support

HSOF Version 3.4 software on HSZ40 controllers is supported by the following operating system versions:

- DIGITAL UNIX™ Versions 3.2d, 3.2g, 4.0b, and 4.0d
- DIGITAL UNIX™ Versions 4.0 and 4.0a with the following patches:
 - V4.0 requires patch OSF 400-114
 - V4.0a requires patch OSF 405-034
- OpenVMS Alpha™ Versions 6.2, 7.0, and 7.1
- Windows NT® Server Version 3.51 and 4.0

Host Adapter Support

The following host adapters are supported by the DIGITAL UNIX operating system for HSZ40 controllers:

- KZTSA (for DEC 3000™ systems) adapter firmware version A11
- PMAZC (for DEC 3000 systems - requires a DWZZ-series signal converter) adapter firmware version 2.0
- KZMSA (for DEC 7000™ and DEC 10000™ systems and for DIGITAL AlphaServers 8200 and 8400 - requires a DWZZ-series signal converter)
- KZPSA (for DIGITAL AlphaServers 1000/2000/2100/8200/8400) adapter firmware version A10

The following host adapters are supported by the OpenVMS Alpha operating system Version 6.2 and higher for HSZ40 controllers:

- KZTSA (for DEC 3000 systems) adapter firmware version A11 and higher
- KFTIA (for TurboLaser 8200 embedded SCSI) adapter firmware version 2.46 and higher
- PMAZC (for DEC 3000 systems - requires a DWZZ-series signal converter) adapter firmware version 2.1 and higher
- KZMSA (for DEC 7000 and DEC 10000 systems - requires a DWZZ-series signal converter)
- KZPAA (for DIGITAL AlphaServers 1000/2000/2100 systems)
- KZPSA (for DIGITAL AlphaServers 1000/2000/2100/8200/8400) adapter firmware version A10 and higher

The following host adapters are supported by the Windows NT operating system Version 3.51 for HSZ40 controllers:

- KZPSA (for DIGITAL AlphaServers 400/1000/2000/2100) adapter firmware version A10 and higher

Device Support

HSOF Version 3.4 software supports the devices listed in Table 1 through Table 4 at the indicated minimum hardware and microcode levels.

Table 1 Supported Disk Drives

Device	Capacity in Gigabytes	Minimum Microcode Version	Minimum Hardware Version
RZ25-VA	0.43	0900	B01
RZ26-VA	1.05	T392	D02
RZ26L-VA/VW ¹	1.05	440C	A01
RZ26N-VA/VW ¹	1.05	446	A01
SWXD3-SF/WF ¹	1.05	446	A01
DS-RZ26N-VZ ¹	1.05	1003	A01
DS-RZ1BB-VW	2.10	LYJO/0656	A01
RZ28-VA/VW ¹	2.10	435E	A01
RZ28B-VA	2.10	0003	A01
RZ28D-VA/VW ¹	2.10	0008	A01
SWXD3-SG/WG ¹	2.10	0008	A01
RZ28M-VA/VW ¹	2.10	0466	A01
DS-RZ28M-VZ ¹	2.10	1003	A01
SWXD3-SH/WH ¹	2.10	0466	A01
RZ74-VA	3.57	T427B	B07
DS-RZ1CB-VW	4.1	LYJO/0656	A01
RZ29B-VA/VW ¹	4.3	0007	B01

Table 1 Supported Disk Drives

Device	Capacity in Gigabytes	Minimum Microcode Version	Minimum Hardware Version
SWXD3-SE/WE ¹	4.3	0007	C02/A01
DS-RZ1CF-VA/VW	4.3	0372/N1H1/1214	A01
DS-RZ1DB-VW	9.1	LYJO/0307	A01
DS-RZ1DF-VA/VW	9.1	0372/N1H1/1214	A01
DS-RZ40-VA	9.1	LYGO	A01
DS-RZ1DD-VA/VW	9.1	0305	A01
DS-RZ1EF-VA/VW	18.2	0372/N1H1	A01
DS-RZ1ED-VW	18.2	0305	A01

Table 1 Notes:

¹ Wide disk drives require a SWXSS-06 shelf.

All drive "VW" models require DS-SWXSS-06 wide device shelves.

NOTE

Any accidental use of the ADD TAPE command will result in conditions requiring reinitialization of the controller.

Table 2 Supported Tape Drives

Device	Capacity G= Gigabytes T=Terabytes	Minimum Microcode Version	Minimum Hardware Version	Notes
TL812	960/1920G	1.2 robot /CC33 drive	A01	1,2,3,4,5
TL822	5280/10560G	1g4F robot /CC33 drive	A01	1,2,3,4,5
TL826	3520/7040G	1g4F robot /CC33 drive	A01	1,2,3,4,5
DS-TL893	924/1848T	V2A/5A	A01	1,2,3,4,5
DS-TL894	1.68/3.36T	V1.24	A01	1,2,3,4,5
DS-TL895	3.1/6.2	230	A01	
DS-TL896	6.16/12.32T	V2A/5A	A01	1,2,3,4,5
TZ87-VA	10/20G	930A	A01	3,5,6
TZ87N-VA	10/20G	930A	A01	3,4,5,6
TZ87-TA	10/20G	9514	B02	1,2,3,6
TZ875-NT	50/100G	930A	A01	1,3,5,6
TZ875-TA	50/100G	930A	A01	1,3,5,6

Table 2 Supported Tape Drives

Device	Capacity G= Gigabytes T=Terabytes	Minimum Microcode Version	Minimum Hardware Version	Notes
TZ877-AE/AF	70/140G	930A	A01	1,3,5,6
TZ88N-VA	20/40G	CC33	A01	3,4,5,6
TZ885-NT/NE	100/200G	CC33	A01	1,3,4,5,6
TZ887- NT/NE	140/280G	CC33	A01	1,3,4,5,6
DS-TZ89N-VW	35/70G	141F	A01	3,4,5,6,7
DS-TZ89N-TA	35/70G	141F	A01	1,3,4,5,6
DS-TL890	560/1120G	3.23 robot/V55 drive	A01	1,2,3,4,5
DS-TL891	350/700G	3.23 robot/V55 drive	A02	1,2,3,4,5
DS-TL892	350/700G	3.23 robot/V55 drive	A02	1,2,3,4,5
DSTZS20	25/50	01aj	A01	

Table 2 Notes:

1. Requires 0.2 meter SCSI-1 to SCSI-2 transition cable, Compaq internal part number 17-03831-01 for DWZZA-AA, and Compaq part number 17-04367-01 for SSB DWZZA-VA and DWZZB-VW.
2. Requires SWXA2 single-ended to differential SCSI signal converter.
3. Capacity values represent compressed data. The compression factor is device dependent based on individual device algorithms.
4. Cannot read TK50, TK70 or TZ30 formatted tapes.
5. Requires a KZPSA or PMAZC host adapter.
6. Tape device code load is supported.
7. Wide tape devices require a SWXSS-06 shelf with an 8-bit I/O module

Table 3 Supported Solid State Devices

Device	Capacity in Gigabytes	Minimum Microcode Version	Minimum Hardware Version	Notes
EZ31-VW	0.134	V064	A01	2, 3
EZ32-VW	0.268	V064	A01	2, 3
EZ51R-VA	0.10	V096	D01	1, 2, 3
EZ54R-VA	0.42	V096	A01	1, 2, 3
EZ58R-VA	0.85	V109	C01	1, 2, 3
EZ64-VA	0.475	V064	A01	2, 3
EZ64-VW	0.475	V070	A01	2, 3
EZ69-VA	0.950	V064	A01	2, 3

Table 3 Supported Solid State Devices

Device	Capacity in Gigabytes	Minimum Microcode Version	Minimum Hardware Version	Notes
EZ69-VW	0.950	V070	A01	2, 3
EZ454	.536	Y018	A01	2, 3
EZ832	3.2	Y018	A01	2, 3

Table 3 Notes:

- 1 Code load supported for these drives
- 2 Formatting supported for these drives
- 3 Do not warm-swap solid-state disk drives. Make sure power to the device shelf is turned off before removing or inserting this device.

Table 4 Supported CD-ROM Readers

Device	Capacity in Gigabytes	Minimum Microcode Version	Minimum Hardware Version
RRD42-VB/VU	0.6	1.1a	A01
RRD43-VA	0.6	0064	A02
RRD44-VA	0.6	3493	A02
RRD45-VA/VU	0.6	1645	A01
RRD46-VA	0.6	1337	A01
RRD47-VA	0.6	1206	A01

Table 4 Notes:

Do not warm-swap CD-ROM drives. Make sure power to the device shelf is turned off before removing or inserting this device.

New Items

HSOF Version 3.4 corrects some problems that were identified after the release of HSOF Version 3.2.

Host-Level I/O Failures

This release addresses the problem in which host-level I/O failures occur due to a storageset unit not-ready condition. This condition is caused by disk devices becoming spontaneously not ready or not responding to controller read or write commands.

Correction for TILX Incompatibility with Disks

In previous versions of HSOF software, data integrity problems could infrequently occur if the tape in-line exerciser (TILX) was run on tapes attached to a controller on which disks were also configured. This problem is corrected in HSOF Version 3.4.

EMU Alarm Clarification

The environmental monitoring unit (EMU) alarm sounds for individual device failures, but does not sound for storageset failures.

Action for Repeated Reboots

Very rarely, a hardware failure might cause a controller to reboot repeatedly, preventing preferred disk devices from completing failover to the dual-redundant partner. HSOF Version 3.4 contains a modification so that if the same bugcheck repeats itself three times in a ten minute period, the controller will shutdown with no restart to permit the disk devices to failover to the working controller in a dual-redundant pair.

Updated Storageset Limits

The following limits apply to storagesets configured on single controller or dual-redundant controller configurations:

- A mirrorset can have a maximum of 6 members.
- A stripeset or RAIDset can have a maximum of 14 members.
- There can be a maximum of 20 mirrorsets and/or RAIDsets.
- There can be a maximum of 30 storagesets (RAIDsets, mirrorsets, and/or stripesets).
- There can be no more than 32 physical device members for a unit.
- Each storageset can store a maximum of 256 GB.

Write-Back Cache (WBC) Battery Replacement

Please observe the two year posted replacement period for the batteries as specified in the *Instructions for Write-Back Cache Battery Service Label* (FRU Insert EK-WBCIN-FI rev B01).

Support for Large-Drive Formatting

This release supports formatting of large disk devices (9 GB and 18 GB).

Support for up to Fourteen 18 GB Drives

The maximum storageset size was increased to 256 GB so that the controller can support up to fourteen 18 GB drives.

New Host Mode “F” for Support of Sun Solaris Operating System

Host Function Mode “F” has been added to the list of available operating system options in support of multiple-bus failover on Sun operating systems platforms. Host Function Modes are described in the *HSZ40 Array Controller HSOF V3.1 CLI Reference Manual* under the SET THIS_CONTROLLER and SET OTHER_CONTROLLER CLI command description.

NOTE: All customers running the Sun Solaris operating system should select Host Mode “F” even if they are not using multiple-bus failover mode. Improper host operation may occur if Sun Solaris systems are connected to an array controller set to a host mode other than “F”. Select Host Mode “F” through the CLI window.

Table 5
Host Mode Function Table

Mode	Description
A	Normal (default) mode: OpenVMS® Digital UNIX® Hewlett-Packard® UNIX
B	IBM AIX®
C	HSZ15
D	Microsoft® WindowsNT®
E	Silicon Graphics IRIX®
F	Sun Solaris®

NOTE: When loading an older version of HSOF code that does not support Host Function Mode F:

- Change the host function mode to one that is supported by the older (previous) code version.
- Reboot the controller before loading the older code.

The controller goes into an “UNKNOWN” Host Mode Function state after:

- Host Function Mode “F” is the selected mode and
- The controller is rebooted with an older code version not supporting mode “F”.

Controller behavior is unpredictable at this point.

Hot Swapping Devices

When hot swapping a device, wait 90 seconds after you restore power before enabling the bus, issuing CLI commands to the controller, or allowing any activity to the controller.

Features from Previous Releases

The following list describes HSOF Version 3.1 and 3.2 features not documented in other manuals. For more information on the HSOF features, refer to

- *HSZ40 Array Controller HSOF Version 3.1 Configuration Manual*
- *HSZ40 Array Controller HSOF Version 3.1 Service Manual*
- *HSZ40 Array Controller HSOF Version 3.1 CLI Reference Manual*

Battery Handling

Diagnostic testing is performed on the write-back cache batteries when the controller first initializes, and then periodically after it has become fully charged. This section clarifies battery-related topics.

Battery Handling and the CACHE_UPS Switch

If the CACHE_UPS switch is activated, the following behavior is true at all times:

- no battery checks are performed
- no battery condition is reported or messages sent
- no action is taken in the event of battery failure



CAUTION: Use of this setting without a functional uninterruptible power supply (UPS) in place may result in data loss if power is interrupted and batteries have failed.

When the CACHE_UPS switch is enabled, the controller ignores the condition of the write-back cache batteries because a UPS is assumed to be in use. Note that HSOF software does not have the capability to monitor the remaining capacity of a UPS. There are many variables in a UPS configuration; some configurations may put data at risk if the UPS is exhausted. For example, if UPS power is lost to the entire host/storage system without warning, write-back cache data is maintained by the cache batteries only. With CACHE_UPS set, the state of the batteries is unknown and data could be at risk.

Battery Handling and Cache Policy

The settings you choose for Cache Policy (A or B) affects access to RAIDsets and mirrorsets during the initial test only, and determines the cache mode the controller uses during initial test only.

Initial test begins when the controller is turned on and continues until the battery is charged, or up to ten hours. Initial testing includes a recharge of the battery after potential discharge during shutdown. Every four minutes, the software tests the battery. Full caching operations begin when the battery is fully charged.

Cache Policy A is the default setting. Cache Policy A and B apply only to a "low" battery from initialization until either:

- the battery becomes fully charged or
- 10 hours elapse without the battery becoming fully charged (in this case, failed battery action is taken, as described in "Failed Battery Action," in these release notes.)

After a battery has become fully charged, Cache Policy A or B no longer applies, and regular periodic battery tests are performed.

The following table summarizes the effect of both cache policy settings on access to RAIDsets and mirrorsets when a battery is "low" during the initial test period.

Policy	RAID/Mirrorset access	Cache Mode
Cache Policy A	no access	write-through on individual disk units (also called JBOD)
Cache Policy B	access	write-through on RAID/mirrorsets and individual disk units

NOTE: Write-through cache mode is not a 100% guarantee of user data consistency within storagesets (RAID and mirrorsets). This is because in these storagesets, there is an inherent delay in the writing of data to the different members. If a power failure occurs between the writing of some members and others (an extremely narrow window), data on the various members will be inconsistent. Therefore, Cache Policy A (which denies access to RAIDsets /mirrorsets on controllers with low batteries) is the only 100% guarantee of user data consistency. That is why Cache Policy A enforces loss of storageset access in the event of a battery that does not pass the battery test.

NOTE: HSOE software makes every attempt to notify the user that a battery problem (not good or open circuit) has occurred by printing a message to the console and posting an error to the host errorlog. However, not all operating systems present errorlogs reliably.

Failed Battery Action

If a battery passes the initial test, cache policy no longer applies, and periodic testing begins. During periodic testing, the battery is tested every 24 hours. When a failed battery is detected during either initial or periodic testing, the following failed battery action is taken:

Dual HSZ40s (dual batteries on each cache module and partner are running and have good batteries):

- Controller performs controlled shutdown
- All units failover to partner
- No auto-reboot after shutdown
- Manual restart before battery replacement causes units to "failback" leading to no access to RAIDsets and mirrorsets

Single HSZ40:

- No shutdown
- No RAIDset or mirrorset access permitted
- Individual disk units accessed in write-through mode

Extending the Life of Your External-Cache Batteries

Occasionally, circumstances will require you to shut down your controller and restart it. If the correct steps for turning off power to an HSZ40 array controller configuration with write-back cache are not followed, there is potential for loss of data that may exist on any devices connected with them. In addition, if you are turning off the power to the controller subsystem for any reason for longer than 4 days (such as a holiday, system move, or replacing a bad SCSI host cable), you will need to turn off the external cache batteries (ECBs) to prevent them from discharging. To avoid problems when the controller restarts, always use the following process to shut it down.



CAUTION: Allowing the write-back cache batteries to discharge completely, and leaving them in a discharged state for any length of time, could result in permanent and irreversible degradation to the batteries.

Shutting Down a Controller

1. Use the proper procedures for shutting down the operating system if the host system is also going to be turned off.
2. If the host is not going to be turned off, it is not necessary to shut down the host system, but use the proper operating system procedures to dismount any units that are accessed through the HSZ40 array controllers.
3. If the controller configuration contains any devices or storagesets that are write-back cache enabled, and the system is going to be turned off for an extended length of time, the batteries on the write-back cache modules drain, causing the data in the cache modules to be lost. If you have RAIDset or mirrorset units, or single devices with write-back caching turned on, SET NORUN on all units.
4. When the dismount and/or the operating system shutdown procedures are complete, invoke the controller SHUTDOWN commands on the controllers.



CAUTION: Do not turn off the power to the controller subsystem until all shutdown procedures have successfully completed.

5. If you have a dual-redundant controller configuration, shut down each controller one at a time, using the following commands:

```
SHUTDOWN OTHER_CONTROLLER
```

```
SHUTDOWN THIS_CONTROLLER
```


If you have a non-redundant controller configuration, only the SHUTDOWN THIS_CONTROLLER command is necessary.

The green reset LED stops blinking when the SHUTDOWN command completes.

- When the controller SHUTDOWN command successfully completes, turn off power to the controller subsystem (or just the controller shelf, if you are not shutting down the entire system, by unplugging the power supplies in the controller shelf).

Disabling the Write-Back Cache Batteries

Refer to Chapter 2 in *HSZ40 Array Controller Version 3.1 Service Manual*, for instructions on removing and replacing the controller module and write-back cache module.

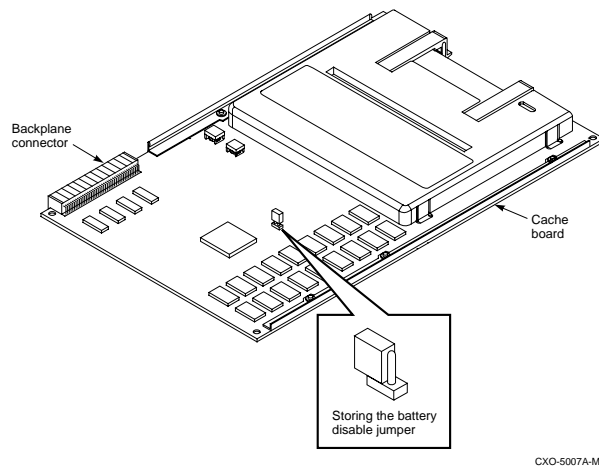

CXO-5007A-MC

Figure 1. Location of Write-Back Cache Module Batteries

- Remove the controller module.
- Remove the write-back cache module.
- Remove the battery disable jumper and replace it so that both pins are covered. The battery is no longer powering the cache.
- Replace the write-back cache module.
- Replace the controller module.

Restarting the Controller

- Before you restore power to the subsystem, remove the controller module, and the write-back cache module. Remove the battery disable jumper and replace it so it is only covering one pin, then reassemble the unit.
- If you removed the PCMCIA card, hold down the reset button while inserting the PCMCIA card. When you release the reset button, the controller restarts.
- If you did not remove the PCMCIA card, press the reset button and the controller restarts.

Logical Device Event Reports

Under certain circumstances the Port, Target, and LUN fields contained in event reports associated with storageset logical devices, Event Log displays, as well as sense data responses, will be set to 255 (decimal) instead of the Port, Target, and LUN of the first physical device in the storageset. In addition, when the Port, Target, LUN are set to 255, the Device Type is set to 0 (magnetic disk device), and the Device Product ID and Device Firmware Revision Level fields will be ASCII space filled.

Logical Block Address Does Not Match for MEDIUM ERROR

The Logical Block Address (LBA) is a number used to identify a block on a mass storage device. The LBA that appears in the Information field of an Event Log (%EVL) display when the Sense Key field is MEDIUM ERROR does not agree with the LBA number contained in the Information field of the extended sense data that is sent to the host system. It is one less than the number in the extended sense data.

Adding RAIDsets When Battery Condition is Low

You can use the ADD RAIDSET and ADD MIRRORSET commands, regardless of the write-back cache battery condition. However, if the cache_policy is set to A and the batteries are low, the controller does not allow access to any RAIDsets or mirrorsets. Cache_policy A requires that the cache batteries be fully charged before you can use RAIDsets or mirrorsets.

Drive-Level Event Reports

Under certain circumstances the "devtype" (device type) field contained in drive-level event reports %EVL displays as well as error logs, will contain the value 1F (hexadecimal). When "devtype" is 1F the content of the "device identification" and "device serial number" fields are undefined and should be ignored.

This is a permanent restriction.

Saving the Subsystem Configuration

The SAVE_CONFIGURATION switch is intended to be used to provide a means to restore nonvolatile (NVRAM) contents when a controller in a single-controller module configuration is replaced. The SAVE_CONFIGURATION switch cannot cross hardware revisions or software versions. SAVE_CONFIGURATION is not available for upgrades of firmware or hardware, and does not perform inter-platform conversions. For example, do not use SAVE_CONFIGURATION to upgrade from HSOF Version 3.2, or from an HSD30 to an HSZ40 array controller.

The controller stores the subsystem's configuration—the storagesets you configured, the switches set for each, the HSOF patches you've installed, and so on—in its nonvolatile memory. This means that, if the controller fails in a nonredundant configuration, you would have to reconfigure the subsystem from scratch. (In a dual-redundant configuration, this information is stored by both controllers, which effectively eliminates the risk of losing it.)

NOTE: Compaq recommends that the SAVE_CONFIGURATION switch only be used for nonredundant controller configurations. To save the configuration information for dual-redundant configurations use the SET FAILOVER COPY= command.

If you are operating a nonredundant configuration subsystem, Compaq recommends saving the subsystem's configuration on at least one of the devices or storagesets with the following command:

```
INITIALIZE storageset_name SAVE_CONFIGURATION
```

When initializing a device or storageset with the SAVE_CONFIGURATION switch, the controller copies the subsystem's configuration to the disk drives. If you use the switch for a multi-device storageset, such as a stripeset, the complete information is stored on each device in the storageset. The capacity of a device that is initialized with the SAVE_CONFIGURATION switch is reduced by 256KB. This capacity reduction applies to each member of a storageset.

After initializing a storageset with this switch, the controller keeps the copy up-to-date. For example, every time a new patch or storageset is added to the HSOF software, the controller re-copies the new configuration to all storagesets that were initialized with the SAVE_CONFIGURATION switch.

If a controller in a nonredundant-configuration fails, its replacement automatically searches the devices in the subsystem for a saved configuration. If it finds a saved configuration, it transparently loads it into nonvolatile memory and brings the subsystem online. It is unnecessary to issue an INITIALIZE command again after reconfiguring the devices with a new controller.

Compaq does not recommend initializing all of your storagesets with the SAVE_CONFIGURATION switch. Every time you change the subsystem's configuration, the controller writes the new configuration to the storagesets that you initialized with this switch. Too many write operations can adversely affect performance.

If you are upgrading from HSOF Version 5.2 to Version 3.4 in a single-controller configuration, you can refresh the SAVE_CONFIGURATION data on your storagesets to include the new software revision by issuing the following command:

```
SET UNIT xxx WRITE_PROTECT
```

[where xxx is any existing unit on the controller]

```
SET UNIT xxx NOWRITE_PROTECT
```

These commands, which have no net effect, serve to change the contents on nonvolatile memory, causing the updated SAVE_CONFIGURATION information to be automatically written to the SAVE_CONFIG area of all units that have been initialized with this option.

Restrictions on Moving Storagesets to Previous Software Versions

In HSOF Version 2.5, striped mirrorsets reported a different disk geometry than the same non-mirrored stripeset. This has been resolved in Versions 2.7, 3.0, 3.1, 3.2, and 3.4. Striped mirrorsets initialized under these versions report a disk geometry identical to the same nonmirrored stripeset.

Due to this improvement, observe the following restrictions when moving stripesets to Version 2.5 software.

- Striped mirrorsets created under HSOF Version 2.7, 3.0, 3.1, 3.2, or 3.4 software cannot be used on previous versions; the metadata is incompatible.
- Stripesets that are converted to a striped mirrorset using the MIRROR command under HSOF Version 2.7, 3.0, 3.1, 3.2, or 3.4 software cannot be used on previous versions. You must UNMIRROR each of the members to return to an earlier version.
- Stripeset clones that are created under HSOF Version 2.7, 3.0, 3.1, 3.2, or 3.4 software with the CLONES utility cannot be used with previous software versions.
- Containers initialized with the SAVE_CONFIGURATION switch introduced in HSOF Version 2.7 cannot be used with versions prior to Version 2.7.

Striped mirrorsets created under previous software versions and used with HSOF Version 2.7, 3.0, 3.1, 3.2, or 3.4 software carry forward the same disk geometry they had under the previous version. If possible, back up your data and reinitialize the stripesets under Version 2.7, 3.0, 3.1, 3.2, or 3.4 to take full advantage of disk geometry improvements.

Unit Problems after Battery Low

An unusual combination of circumstances may cause a unit to unexpectedly become inoperative or report lost data after a write-back cache battery changes state from “low” to “good.” No data has been lost. Reset the controller to correct the unit state.

CLEAR_ERRORS LOST_DATA Command

When you enter the CLEAR-ERRORS LOST_DATA command for a RAIDset-based unit, always enter the command on the controller that owns the unit (through the preferred path). Entering the command from the companion controller in a dual-redundant configuration will not clear the lost data.

Only One Switch per CLI Command Recommended

Certain switches to CLI commands are incompatible. To avoid problems in this area, only specify one switch per CLI command. For example, to set both WRITEBACK_CACHE and NORUN on unit D102, use the following two commands:

```
SET D102 WRITEBACK_CACHE
SET D102 NORUN
```

CFMENU Constraints

CFMENU can only delete single sparesets. Delete sparesets one at a time. Delete spareset members one at a time by responding Y (yes) to one member, then responding N (no) to the rest of the spareset’s members. CFMENU deletes the spareset member.

You can also delete spareset members using the CLI command DELETE SPARESET disk_name. While you still have to delete each member individually with separate CLI commands for each one, this is a faster method for deleting multiple spareset members.

CLONE Utility Constraints

The CLONE utility cannot be used with partitioned units.

When running the CLONE utility in a dual-redundant controller configuration, do not issue any CLI commands to devices that are involved in the clone operation.

Low/Failed Battery on Dual-Redundant Configurations with Preferred Paths

If an external cache battery goes low or fails for a controller in a dual-redundant configuration and preferred paths have been set, that controller's units may go AVAILABLE on the "OTHER" controller and INOPERATIVE on it. This causes a MOUNT VERIFY on the units from OpenVMS. You will need to issue the SET unit-name NOPREFERRED_PATH command which will allow the units to go out of MOUNT VERIFY. Later you can reissue the SET unit-name PREFERRED_PATH command to the affected units.

Device Adds, Moves, and Changes

The controller maintains configuration maps of device types and locations and uses those maps for communicating with devices. If you add, move, or change devices while the controller is powered off and without changing the controller configuration first, the controller is not able to work with the changed devices when it returns to service.

Tape Drive Firmware Revision

If you are not using HSUTIL to install your new tape firmware, do the following: Before installing a new version of tape drive firmware, delete the tape drive completely from the controller configuration. You can re-add the tape drive after the firmware installation is complete. This prevents interrupts to the drive during the code loading operation.

Running CONFIG or CFMENU Utilities During Backup or Copy Operations

Do not run the CONFIG or CFMENU utilities during a tape backup or copy operation.

Changing Host Adapter Types

If for some reason you change your host adapter and maintain the same node number, you MUST restart your controller or controllers.

Moving Write-Back Cache Modules

When moving a write-back cache module to a new environment (that is, different controller, different devices), it is very important that you perform a clean shut down of the controller and clear any data from the cache. Follow these steps to move a write-back cache module:

1. Shut down the controller and flush unwritten data from the cache module using the appropriate CLI command:

```
SHUTDOWN THIS_CONTROLLER
```

or

```
SHUTDOWN OTHER_CONTROLLER
```

2. Wait for the SHUTDOWN command to complete and verify that the controller does not report any errors.
3. Remove the controller and cache module following the instructions in the *HSZ40 Array Controller HSOF Version 3.1 Service Manual*.

The SHUTDOWN command flushes cache data to the devices, and you can install the module in another location without problems caused by uncleared cache data.

Documentation Additions and Corrections

This section describes additions and corrections to documentation for the HSZ40 controller including:

- *HSZ40 Array Controller HSOF Version 3.1 Configuration Manual*
- *HSZ40 Array Controller HSOF Version 3.1 Service Manual*
- *HSZ40 Array Controller HSOF Version 3.1 CLI Reference Manual*
- *HS Family of Array Controllers User's Guide*

Replacing a Controller with C_SWAP

The procedure in *HSZ40 Array Controller HSOF Version 3.1 Service Manual* for restarting the subsystem after replacing a controller with C_SWAP should contain the following note:

Note: The following error message is normal. Please continue with controller configuration.

```
Other controller not responding - RESET signal asserted.
```

Please note these additional corrections:

- In the *HS Family of Array Controllers User's Guide* on page 5-28, the second paragraph should read:

Mirrorsets that have at least one NORMAL or NORMALIZING member other than the one being removed automatically adjust to the removal of the device.

- In the *HS Family of Array Controllers User's Guide* on page 6-14, the second sentence of section 6.5.5, "Changing RAIDset Characteristics," should begin, "When a RAIDset loses a member..."

CACHE_UPS

The following switches have been added to the CLI commands SET THIS_CONTROLLER and SET OTHER_CONTROLLER.

CACHE_UPS
NOCACHE_UPS (Default)



WARNING: Use of this feature without a functional UPS could result in data loss if power is interrupted and batteries have failed.

Specifies whether the controller should perform regular battery condition checks, and whether it should ignore the CACHE_POLICY setting.

Specify cache_ups if your storage subsystem receives power from an uninterruptible power supply (UPS). The controller does not check the condition of the cache batteries, and ignores the CACHE_POLICY setting, meaning that RAIDsets and mirrorsets are always available, regardless of the condition of the cache batteries.

Specify NOCACHE_UPS to have the controller perform regular battery checks and follow the CACHE_POLICY setting for low batteries.

When the CACHE_UPS switch is enabled, the controller ignores the condition of the write-back cache batteries because a UPS is assumed to be in use to maintain power to the write-back cache module in the event of a power failure. Note that HSOF software does not have the capability to monitor the remaining capacity of a UPS. There are many variables in a UPS configuration; some configurations could put data at risk if the UPS is exhausted. For example, if UPS power is lost to the entire host/storage system without warning, write-back cache data is maintained by the cache batteries only.

Upgrading HSOF Software

You can upgrade the HSZ40 controller software using one of the following three procedures depending on whether you are upgrading a:

- Dual-redundant controller installation configuration as a rolling upgrade (changing both program cards simultaneously)
- Dual-redundant controller installation configuration as a shutdown upgrade (changing both program cards simultaneously)
- Single controller

During a rolling upgrade, devices on the redundant pair remain available to the host. The rolling upgrade procedure is recommended only when upgrading to an adjacent version (for example from V3.3 to V3.4.) When performing rolling upgrades, it is required that the most recent software patches, if any, be installed on both the lower and higher code versions. Note that rolling upgrades from V3.2 to V3.4 are permitted.

During a shutdown upgrade, you are required to shut down and then restart the controllers. This procedure typically takes less than 5 minutes to accomplish. All devices on the redundant pair are dismantled prior to the upgrade. Shutdown upgrades should be used when upgrading to a non-adjacent version (for example, from V3.1 to V3.4.)



CAUTION: If JBOD disks that were initialized using the SAVE_CONFIGURATION option on an HSZ40 controller running HSOFF Version 27Z have been moved onto your HSD30 controller, please contact your field service representative before upgrading your HSD30 controller from HSOFF Version 2.7 to HSOFF Version 3.4 software.

NOTE: HSOFF Version 3.4 software waits up to one minute after controller restart before presenting a CLI prompt or accepting commands. This delay does not affect unit availability to the host. The delay provides time for controller internal configuration operations to finish before user commands change the configuration. After you insert the HSOFF Version 3.4 program cards and press the reset button, allow 60 seconds for the CLI prompt to appear.

Dual-Redundant Controller Rolling Upgrade

A rolling upgrade procedure is one in which the disk subsystem does not have to be shut down to upgrade the software. Using the failover capabilities of the controllers, only one controller at a time needs to be shut down, allowing the host system to have disk drive activity from the disk subsystem being upgraded. The rolling upgrade procedure is recommended only when upgrading to an adjacent version (for example from V3.3 to V3.4.) When performing rolling upgrades, it is required that the most recent software patches, if any, be installed on both the lower and higher code versions. Note that rolling upgrades from V3.2 to V3.4 are permitted.

Use the following procedure to install the new HSOFF software while maintaining connectivity to the storage devices:

1. Establish a local connection to the controller through the maintenance port of one of the controllers (“this controller”).
2. Wait for the CLI prompt, and then shut down “other controller” using the following command:

```
SHUTDOWN OTHER_CONTROLLER
```



CAUTION: Before continuing, wait until the Reset button stops flashing and stays lit continuously. This indicates that unwritten data is flushed from the cache module.

3. Remove the PCMCIA program card ESD cover from “other controller”.
4. Press and hold the controller Reset button while ejecting the old program card (release the button after the card is ejected.)
5. Press and hold the Reset button while inserting the new program card in “other controller”. Release the button after the new card is inserted.

NOTE: Wait for the following to happen before continuing:

- The Reset button flashes approximately once per second.

- The maintenance terminal displays a message that finishes with:
other controller restarted
- 6. Read the status of “other controller” by issuing the following command:

SHOW OTHER_CONTROLLER

NOTE: When the SHOW OTHER_CONTROLLER command verifies that the other controller restarted, it is safe to continue.
- 7. Replace the ESD cover on “other controller” and push the locking pins to secure it.
- 8. Is this your first pass through this procedure:
 - Yes - move the maintenance port cable from “this controller” to “other controller” maintenance port and repeat procedure from step 2 to replace the other program card.

NOTE: “other controller” switches with “this controller,” meaning that the controller the maintenance port cable was plugged into originally (“this controller”) becomes “other controller” for the second pass through this procedure.
 - No - You have completed the procedure.

Dual-Redundant Controller Shutdown Upgrade

This procedure requires that you change your dual-redundant configuration into two single controller configurations for the HSOF Version 3.4 software upgrade. You must shut down and restart both controllers during this upgrade. Units will be unavailable to the host system during this time. Before upgrading the controller software, prepare the host system for this situation by dismounting units or shutting down the system.

NOTE: Compaq does not recommend the use of the SAVE_CONFIGURATION option for dual-redundant configurations.

Use the following procedure to upgrade the HSOF software in a dual-redundant configuration:

1. Stop all I/O to the units in your subsystem.
2. Establish a local terminal connection to one of the controllers.
3. Enter the SET NOFAILOVER command to take the controllers out of dual-redundant (failover) mode.

```
$ SET NOFAILOVER
```

4. Enter the SHUTDOWN command.

```
$ SHUTDOWN THIS_CONTROLLER
```

Wait for the command to complete. When the controller shuts down, the green RESET (//) LED stops flashing and stays lit.



CAUTION: Failure to shut down the controller in this step might result in problems with RAIDsets and cache when the controller is reset.

5. Remove the electrostatic-discharge (ESD) shield covering the PCMCIA program card.
6. Press and hold down the reset button while ejecting the program card.
7. Release the reset button.
8. Remove the program card.
9. While holding in the controller reset button, insert the V3.4 program card, pressing the card in until the eject button extends outward.
10. Release the reset button.
11. Reinstall the ESD shield.

The controller restarts. Communication with the host system begins as described in *HSZ40 Array Controller HSOF Version 3.1 Configuration Manual*.

12. Repeat all of the previous steps for the second controller.
13. After you complete all of the above steps on both controllers, put the controllers back into dual-redundant (failover) mode by entering the following command:

```
$ SET FAILOVER COPY=CONFIGURATION_SOURCE
```

Single Controller Upgrade

Use the following procedure to upgrade the HSOF software in a nonredundant (single) controller:

1. Halt all I/O activity to the controller using the appropriate procedures for your operating system.
2. Connect a maintenance terminal to the controller.
3. Enter the shutdown command to take the controller out of service:

```
SHUTDOWN THIS_CONTROLLER
```



CAUTION: Failure to shut down the controller in this step could result in problems with RAIDsets and cache when the controller is reset.

Wait for the command to complete. When the controller halts, the green Reset (//) LED stops flashing and stays lighted, and port lights 1, 2, and 3 are lighted continuously.

4. Remove the ESD shield covering the PCMCIA program card.
5. While pressing and holding the reset button, press the program card eject button to eject the program card from the controller.
6. Release the reset button.
7. Remove the program card.
8. While holding in the controller reset button, insert the V3.4 program card, pressing the card in until the eject button extends outward, then release the reset button.

After the controller begins restart, it will not allow you to enter any CLI commands for approximately 60 seconds. This delay does not affect unit availability to the host. When the controller is correctly initialized, the green reset indicator flashes once every second.

9. Reinstall the ESD shield.

Identifying Your HSOF Revision Level

You can identify HSOF Software Version 3.4 by entering the `SHOW THIS_CONTROLLER` command at the CLI prompt. The resulting display lists the software revision level as version "V34Z-x."

Order Numbers

The following table contains order numbers for controller options and preconfigured options.

Table 7
Order Numbers

Device	Description
HSZ40-BA/CA	StorageWorks HSZ40 Array Controller with no cache module, 6 SCSI-2 device ports
HSZ40-BD/CD	StorageWorks HSZ40 Array Controller with a 16 MB read cache module, 6 SCSI-2 device ports
HSZ40-BF/CF	StorageWorks HSZ40 Array Controller with a 32 MB read cache module, 6 SCSI-2 device ports
HSZ40-XD	16MB read cache module
HSZ40-XF	32 MB read cache module
HSZ40-YX	Write-back cache option kit -- contains two onboard cache batteries, one battery bracket, one write-back cache license

The following table contains the software and documentation order number.

Table 8
Software and Documentation Order Number

Device	Description
QA-2YJAC-HS	HSOF Software and Documentation