




RouteAbout Access EI/MP Release Notes

Version 1.1

April 1996

As warranted, Digital changes the firmware of this device to make functional enhancements or to correct reported problems. These release notes identify enhancements and changes to the firmware that impact end-user operations. They also contain firmware and software requirements, and list updates in this release as well as known conditions and restrictions that apply to the operation of the RouteAbout Access EI module.

The following example describes the firmware version number:

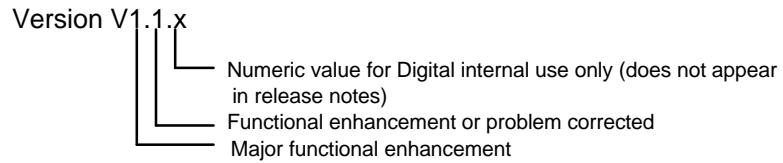

Contents

Firmware Requirements	2
Software Requirements	2
Reloading Software from CD-ROM	2
Known Conditions and Restrictions	3

AA-QQP5A-TE

Firmware Requirements

Digital Equipment Corporation requires that you use DEChub 900 MultiSwitch firmware version 4.1, or higher, to manage the RouteAbout Access EI if installed in a DEChub 900 MultiSwitch.

Software Requirements

If you are using HUBwatch to manage the RouteAbout Access EI, Digital Equipment Corporation requires that you install HUBwatch software version V4.1, or higher.

Reloading Software from CD-ROM

Your RouteAbout Access EI comes preconfigured with diagnostics and functional software. This software will function right immediately, and does not need to be loaded. However, in the unlikely event that the preinstalled software image becomes corrupted, you can download the software images found on your CD-ROM to the RouteAbout Access EI .

The RouteAbout Access EI uses **bootp/TFTP** in order to load software over the network. You must first setup your loadhost to honor bootp requests from your particular RouteAbout. This task is operating system specific. In the case of UNIX systems, this involves adding an entry into the **/etc/bootptab** file. Other operating systems may differ.

If the RouteAbout Access EI router software is operational, you can use following procedure to reload the RouteAbout software or diagnostic image.

Step	Action
1	Copy the RouteAbout software image to your TFTP area.
2	From the RouteAbout Console interface, select the Gateway user configuration process (talk 6).
3	Enter the boot command to access the TFTP Boot/dump configuration interface. You can now perform one of the following operations: <ol style="list-style-type: none">Define a boot file location using the add boot command and reload using the MOS command reloadReload interactively using the load remote command

NOTE

If the upgrade is over a WAN port, you might need to set up static routes on any intermediate routers. When the RouteAbout Access is upgrading, it is not actively routing. If routing table entries time out for the unit being upgraded, the TFTP copy of the upgrade image might fail.

LED Configuration During Reload

If it becomes necessary to reload the RouteAbout Access EI software, a special LED pattern will be blinked to indicate that the software is currently being written to flash RAM (which could take up to 10 minutes). It is VERY IMPORTANT that you do not interrupt power to the RouteAbout while this is in process.

Once the software image has been loaded over the network, the Network OK LEDs and ports 1-2 Serial Line OK LEDs will begin to blink in sequence. This pattern will continue until the software has been programmed into flash RAM.

Known Conditions and Restrictions

RouteAbout Access EI module conditions and restrictions are described in this section:

System Configuration

Do not reduce max packet size

Do not set the packet size to low values via the configcommand 'set packet-size'. Values less than 1518 can cause the router to crash with a 'buffer guard word corrupted' message.

Ethernet

ThinWire self test

If the side ThinWire port is in use, and the ThinWire is disconnected from the module, the Ethernet self test will continue to pass.

WAN ports

Half duplex mode

Half duplex mode for SDLC does not function correctly. The RouteAbout will drop RTS before the frame has been completely transmitted. If the opposite end of the SDLC connection ignores frames received in this state, the connection will not function.

SDLC relay and modem signals

In some cases, SDLC relay lines can fail to correctly sense the status of modem signals. In this state, the line will be **down** having failed self test, and **test <n>** commands will return failures. To workaround this problem, **disable int <n>** first before entering the **test** command.

Tinygram compression on PPP links

The RouteAbout always does tinygram compression on PPP links, even if tinygram compression is disabled. This may cause **runt** packets if the router on the other end of the PPP link does not pad the packet back to the Ethernet minimum of 64 bytes.

AA-QQP5A-TE

WAN ports (continued)

Switched/Dial circuits

Destination setting for dial circuits is required. Always enter a destination on dial circuits, even if they are intended for inbound calls only. If you do not, calls for that circuit will be rejected. Inbound calls will be checked against that destination, but will still be accepted if ANY_INBOUND is set.

Frame Relay

Minimum Information Rate fixed

You cannot configure the minimum information rate (MIR) for a frame relay PVC. The router uses a default value of 1/4 of the committed information rate (CIR).

Excess information rate changes not configurable

You cannot configure the percentage by which excess information rate (EIR) changes in response to congestion on a Frame Relay PVC. The router raises EIR by 1/16 of CIR when there is no congestion, and lowers it by 1/8 of CIR when there is congestion.

X.25

N2 Setting Restriction

When configuring the N2 parameter for your X.25 interface, set it to one less than the transmission attempt counter for your X.25 network. The router incorrectly uses this setting as a retry, rather than attempt count.

Inter-Frame Delay Display Incorrect

The Inter-Frame Delay setting for an X.25 interface may display incorrectly. The setting entered by the user is stored correctly, but if displayed with the **list summary** command, the value may not match the configured value. The user-entered setting is used for the actual Inter-Frame Delay on the network.

Received Reset Indication Requires Manual Intervention

If the router receives a reset indication on a X.25 PVC, it fails to restart transmitting packets on the interface. To manually restart the interface, initiate a **test** command on the X.25 net.

Phase IV Adjacencies -- Restriction

Do not configure more than five DECnet Phase IV adjacencies on an X.25 interface. More than five adjacencies will cause the X.25 interface to become blocked.

T1 and T2 Parameters are Truncated

Although you can enter more than two decimal places when configuring X.25 T1 and T2 parameters, the values you entered are truncated to two decimal places.

Console Port

Modem Control Console Port

If a modem is connected to the RouteAbout console port, you should be aware that during the boot sequence DTR will be temporarily deasserted. This may cause the modem to drop the connection if it is set into certain modes. To correct this situation, strap your modem to ignore DTR transitions.

Bootstrap Monitor

When the module is powered up, after the self test completes the **Bootstrap Monitor** is invoked. Under normal conditions, the monitor will automatically transfer control to the router in 5 seconds. While the monitor is running, the SYS_OK LED flashes once per second. If the reset/dump button was held in during the power-up sequence, or if the user types a command to the monitor, the router will not automatically start. To manually start the router, use the monitor's **E** command.

DEChub 900

IP services on a DEChub 900

RouteAbout products do not support IP services for DEChub 900 management when configured as a bridge only with HOST IP address. To use the router for IP services, assign the IP address to a network interface.

Upgrading Procedures

TFTP Load Timeout

The TFTP load timeout value that is specified in the boot config record is not used. Rather, a sliding window timeout is used, which allows TFTP to adapt to changing network conditions.

File Name Size

The maximum file name size in the boot config record is 63 characters.

Upgrade Restriction

Do not logout from the * prompt while an upgrade is in progress. If you do, the console may not be accessible again until the router is power cycled.

AA-QQP5A-TE

IP

Illegal Address/Mask pairs

The command line interface lets you to create an illegal IP address/mask pair (eg, 192.1.1.1/255.0.0.0). The resulting address will not be advertised by the routing protocols, however. Be sure that your address mask is not less restrictive than the default for the class (Class A - 255.0.0.0, B - 255.255.0.0, C - 255.255.255.0).

IP routing and HST mutually exclusive

If you have configured IP routing, and IP host services (HST), you cannot monitor HST from the GWCON process (**talk 5**). HST is only used in the absence of IP routing, so the HST configuration information is ignored and is monitoring if HST is disabled. You can use the information configured in your IP routing configuration to remotely access the router.

Multiple IP addresses on an Ethernet

If more than one IP address is assigned to an Ethernet interface, the first will always be used as the IP source address in ARP requests, even if the requested target IP address is in the same subnet as another interface address.

MAC filtering on IP tunnels

Do not attempt to use MAC filtering on an IP tunnel port.

DHCP Discovery -- Restriction

The router does not correctly respond to DHCP discovery messages.

SNMP

Community string needs to be defined

The router does not have a default community string for SNMP. Many management tools assume that the default community string of 'public' will be present. If the router is configured through the **quick config** process described in the installation guide, a community string of **public** will be created. The community string may also be set from the **installation menu**, or the DEChub 900 setup port. To manually add a community string, go to **SNMP config** and type the name in the **add community <name>** field. See the installation guide for more information.

ifSpeed setting inconsistent

The **ifSpeed** setting reported for serial lines is inconsistent. On PPP lines, the line speed is not calculated. This problem will be fixed in a future release of the firmware.

BRS filtering of SNMP responses

You cannot assign a BRS filter to SNMP responses, since the destination UDP port of an SNMP response may vary depending on the port used by the requestor.

Bridge MIB inconsistencies

There are several problems with the rfc1286 mib.

- dot1dStpDesignatedRoot returns only the MAC address.
- dot1dStpPortDesignatedRoot returns only the MAC address.
- dot1dStpPortDesignatedBridge returns only the MAC address.
- dot1dStpPortDesignatedPort priority and port number bytes are in reverse order.

Bridging

Aging process for MAC addresses

If the bridging MAC address database fills, the bridge will prematurely age MAC addresses in order to make more room in the database. It will first age out any entries that are within 85% of their maximum age. If that does not free enough space, then all entries within 65% of maximum are aged out. This can result in a large number of entries being aged out at the same time, in excess of the space required for new entries.

Static MAC entries

If you statically defined a MAC address to a certain port, the bridge will not learn dynamic information about the address. For instance, if you move the station to a new port, the bridge will still continue to send frames destined to it on the old port.

IPX

Routes received with hop count of 15

The RouteAbout does not correctly handle a received IPX route with hop count = 15. It will ignore the route, though it should store it without propagating.

Network numbers for IP tunnel routes

If you are using IPX tunnelling via IP, IP routers on the tunnel will be entered into the IPX routing table in hexadecimal. For example, an IP router with address 125.125.125.10 on a tunnel with IPX network number 210 will appear as 210/00007d7d7d14.

SAP filters and multiple routes

If an IPX service is learned with two different hop counts, and the higher hop count is filtered by IPX SAP filters, the lower hop count route will also be purged.

OSI

DECnet Phase V and Area Addresses

If you are using DECnet Phase V, do not set an area address that ends with 00-40. This LOC-AREA has a special meaning in Phase V of the default area, that end systems in the absence of a router.

AA-QQP5A-TE

Frame size on ISDN datalinks

If you use IS-IS over a PPP dial circuit, you may find that the configured datalink MTU is not large enough for the IS-IS packets (as indicated by an ISDN.030: Tx Frm too long (2052 > 2047) nt 2 int ISDN/0 message). You can raise this frame size by using the **set frame 4096** command to ISDN config, and then the **set packet 2500** command to GWconfig. Unless you use both commands or your free memory may be exhausted by the 4K buffer size for ISDN.

Level 2 only links

If an OSI link is configured for Level 2 only, Level 1 LSPs will still be sent over the link. This may cause adjacencies to be lost.

Interoperability

Bridging over PPP to DECnis

When configuring a DECNIS to interoperate with a RouteAbout (which cannot process FDDI format packets on PPP links) you must add the following lines to the DECNIS extra_set NCL file.

```
set bridge port <port-to-RouteAbout> Manual Data Link SDU Size 1536
set ppp link <link-to-RouteAbout> Minimum SDU Size 1536
set ppp link <link-to-RouteAbout> Preferred Maximum Receive SDU Size 1536
```

AppleTalk over Frame Relay to DECbrouter 90

The DECbrouter 90 and Cisco routers do not interoperate with the RouteAbout family when using AppleTalk over Frame Relay. This will be fixed in the next release of the software.

©Digital Equipment Corporation 1996. All rights reserved. Printed in U.S.A.

DEC, DEChub, DECnet, RouteAbout, Digital, HUBwatch, HUBloader, MultiSwitch, and the DIGITAL logo are trademarks of Digital Equipment Corporation.

AppleTalk is a registered trademark of Apple Computer, Inc.

IPX is a registered trademark of Novell, Inc.

Cisco is a registered trademark of Cisco Systems, Inc.